

TO: SERVICE MANAGER MECHANICS
PARTS MANAGER

No. 93-4

A. REQUIRED FLAME ARRESTOR REPLACEMENT

Models

MCM 5.7L Alpha Stern Drive Engines Only
Serial Number: 0F000455-0F010698


NOTE: Does not effect MCM 5.7L Bravo Stern Drive, MIE 5.7L Inboard or MIE 5.7L Ski Engines.

Problem

This engine had the wrong model flame arrestor installed. This will cause the engine to run rich.

Correction

Remove cover and look at the flame arrestor.
Without vent hose cross piece - wrong type, must be changed.
With vent hose cross piece – correct type, do not change.

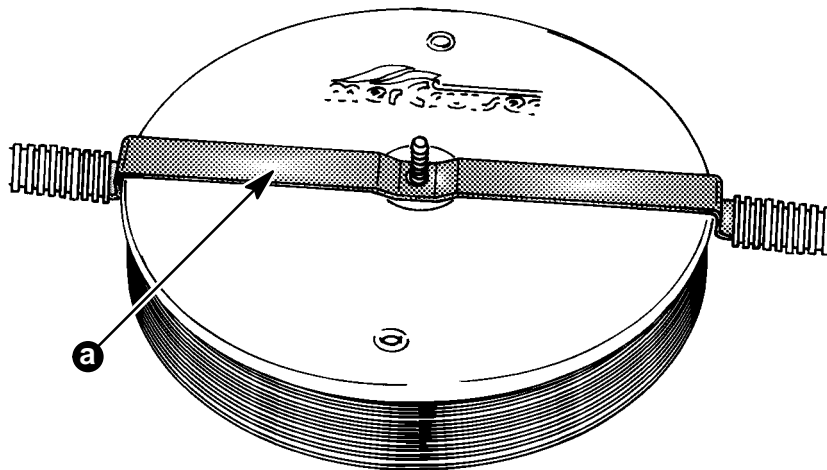

a - Vent Hose Cross Piece

Parts Required

(1) 805298A1 Flame Arrestor

Warranty

Fill out warranty claim and send it to your normal warranty processing center. More than one engine can be put on a claim as long as you list the part number, engine model, serial number and labor hours for each engine on separate lines.

Warranty Code: MP11

Labor: 0.5 Hours

Old Part: Scrap.