

Circulate to: Sales Manager Accounting Service Manager Technician Parts Manager

Foot-Pedal Toggle Switch

Models Affected

Models Covered	Serial Number Range
All Freshwater and Great White Saltwater Models	9B366620 - 9B638784

Situation

Customer may experience problems with the toggle switch disengaging from the constant-on position or the high-bypass position. The customer will have to activate the motor using the micro-switch on the foot-pedal.

Correction

Remove the toggle switch and inspect the switch for broken threads under the nut. If broken threads are found, replace the switch. The switch may have been damaged due to an incorrect assembly process at the factory.

Description	Part Number
Toggle switch assembly	MFP15305T

Warranty

Complete the warranty claim providing:

- Model and serial number of the trolling motor
- 0.3 hour labor
- Warranty Flat Rate Code: SB03

US AND CANADA

Complete/process claim via MercNET or a warranty claim form. Mail to:

Mercury Marine
P.O. Box 1939
Fond du Lac, WI 54936
Fax 1-920-929-5893

INTERNATIONAL

Follow the instructions issued by the Marine Power International Office or by your distributor.

THE INFORMATION IN THIS DOCUMENT IS CONFIDENTIAL AND PROTECTED BY COPYRIGHT AND IS THE PROPERTY OF MERCURY MARINE.

This document is provided for the sole and exclusive use of the original recipient as prescribed by Mercury Marine and may not be distributed or copied, digitally or otherwise, without the prior written consent of Mercury Marine.